
Single Phase Box Pad Installation Instructions:

- 1. Measure the bottom width and depth of the box pad flanges.
- 2. Measure down 6" below the top surface and mark that spot.
- 3. Then measure from that spot to the bottom of the box pad, that is the maximum burial depth.
- Dig a hole approximately 6" deeper than the maximum burial depth and 12" wider than the bottom flange dimensions of the box pad.



- 5. Add 6" of gravel to the bottom of the hole, machine tamp and level it.
- 6. Place the box pad on the leveled gravel bed.
- 7. Using a level, ensure that the top surface is level. If not level, add or remove gravel, re-tamp and level again.
- 8. Back-fill with loose earth material.
- 9. Do not back-fill with chunks of frozen material or large rocks next to the ground sleeve.
- 10. Pack the back-fill material by foot tamping, no machine tamping.

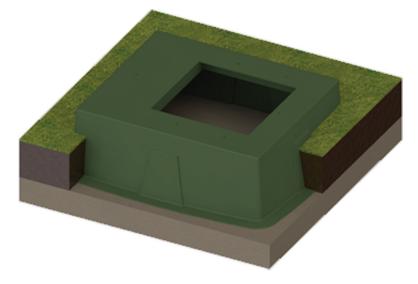

P.O. Box 27 Warren, MN 56762 Tel: 218-745-5095 Fax: 218-745-4990 www.nordicfiberglass.com